

# Manhole Inspection Summary

Manhole # S39Q\_\_009MH

Printed On: 2/27/2009

Page 1 of 4

**Inspection** ☐ Is Incomplete Rating: **3) Fair**

Record Plat: **39Q** Node: **009** Status: **Found**

Insp Date: **10/14/08 9:41 AM**

Incomplete Comments

Crew: **dd**  
Inspector: **jjoirer**  
Firm: **ATS**

**Location** Address: **key highway**

Cross Street: **pierside dr**

**Manhole** Type: **Junction** Location: **Light Highway**

Ground Conditions: **Dry**

☐ Prev. Rehab

Weather: **Dry**

Subject To Ponding: **None**

Comments

**Cover** Shape: **Circular** Diameter: **32** (in.) Length: **0** (in.) Dist A/B Grade: **0** (in.)

Type: **Sanitary**

Condition: **Sound**

Cover Material: **Cast Iron**

Properties: ☐ Bolted ☒ Vented ☐ Water Tight ☐ Water Tight Insert

**Frame** Offset: **4** (in.) Condition: ☒ Sound ☐ Cracked ☐ Leaks

**Chimney / Frame Adjustment** ☐ Exists Material: ☐ Parged Height: **0** (in.)

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☐ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

**Corbel** Material: **Brick** ☐ Parged Type: **Concentric/Eccentric**

Condition: ☐ Sound ☒ **Cracked** ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

**Barrel** Material: **Brick** ☐ Parged

Shape: **Circular** Diameter: **48** (in.) Length: **0** (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

**Bench** ☒ Exists Material: **Brick** ☐ Parged

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

**Channel** Material: **Brick** ☐ Parged

Channel Exposure: **Fully Open** Junc Dist: **0** nearest .5 ft. Azimuth: **0**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris


**Steps** Count: **15** Missing: **0** ☒ **Corroded**

**Surcharge** ☐ Evidence Of Surcharge Depth: **0** (ft.) ☐ Active Surcharge Present

Location View



Top View

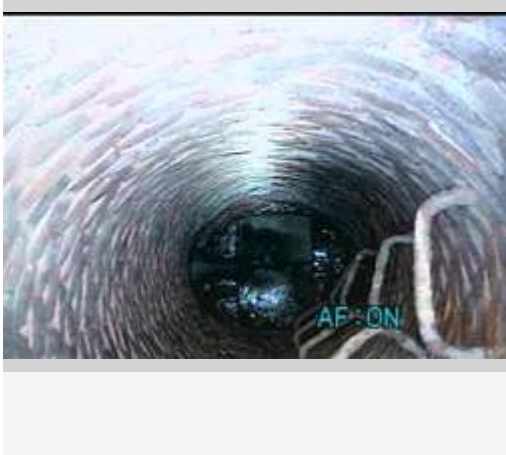

Defect 3



crack in corbel

Defect 2



cor. steps

Defect 1



offset

## Manhole Inspection Summary


Manhole # S39Q\_\_009MH

Printed On: 2/27/2009

Page 3 of 4

30 in. Circular Gravity Sewer  
Pipe Out @ 12 O'Clock

12 O'Clock Outflow

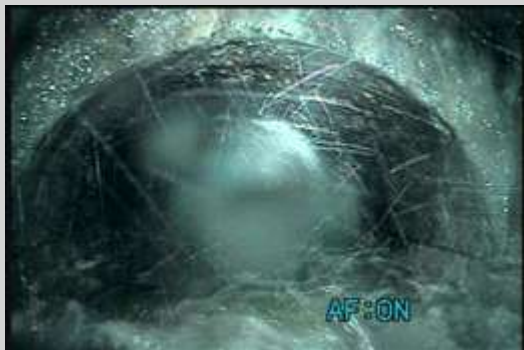

cant get better pic due to flow from pipe@9

Pipe Height: 0 (in.) Direct

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **22.25** (ft.) Flow Characteristics: **Fast**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: 0 (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Unknown**


Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

8 in. Circular Gravity Sewer  
Pipe In @ 3 O'Clock

3 O'Clock Inflow

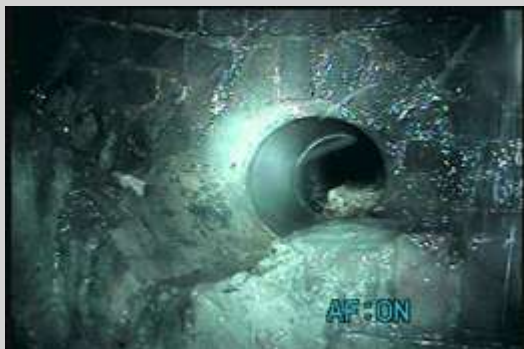

Pipe Height: 0 (in.) Direct

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **20.00** (ft.) Flow Characteristics: **Fast**

Deposits: ☐ None ☐ Mud ☐ Sludge ☒ **Debris** ☐ Grease

Silt Depth: 0 (in.) Deposits Extent: **Light**

Infiltration: **None** Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

## Manhole Inspection Summary

Manhole # S39Q\_\_009MH


Printed On: 2/27/2009

Page 4 of 4

30 in. Circular Gravity Sewer

6 O'Clock Inflow

Pipe In @ 6 O'Clock

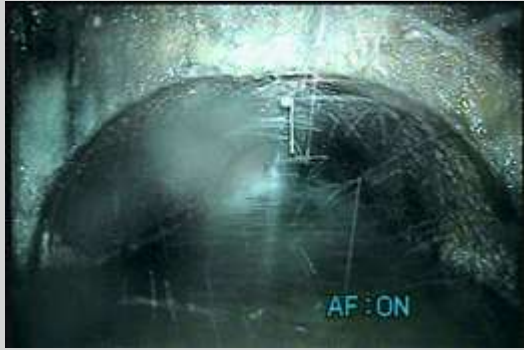

Pipe Height: 0 (in.) Direct

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **22.00** (ft.) Flow Characteristics: **Fast**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ **Debris** ☐ Grease

Silt Depth: 0 (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

8 in. Circular Gravity Sewer

9 O'Clock Inflow

Pipe In @ 9 O'Clock



Pipe Height: 0 (in.) Direct

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **13.00** (ft.) Flow Characteristics: **Turbulent**

Deposits: ☐ None ☐ Mud ☐ Sludge ☒ **Debris** ☐ Grease

Silt Depth: 0 (in.) Deposits Extent: **Heavy**

Infiltration: **None** Pipe Seal Cond: **Unknown**

Drop In @ 9 O'Clock



Drop: **Outside Direct**

Angled: Reading: **0.00** (ft.)

Inv Depth: **20.50** (ft.)

Drop Condition: **Clogged**

Connects To: **Manhole**

☐ Possible Illicit Connection